# **EAPL WellWork & Drilling Daily Operations Report**

## Daily Operations: 24 HRS to 26/06/2007 05:00

Well Name

Fortescue A6a			
Rig Name	Company		
Rig 175	International Sea Drilling LTD (ISDL)		
Primary Job Type	Plan		
Drilling and Completion	D&C		
Target Measured Depth (ftKB)	Target Depth (TVD) (ftKB)		
12,834.3	8,124.0		
AFE or Job Number	Total Original AFE Amount	Total AFE Supplement Amount	
L0501H005	8,931,209		
Daily Cost Total	Cumulative Cost	Currency	
401,385	6,911,814	AUD	

**Report Number** 

21

# Report Start Date/Time Management Summary

Held pit & trip drills. RIH from 1806m to 3288m. Drill 81/2" production hole from 3288m to 3610m. Control drill limiting ROP & GPM as required to maintain ECD below 12.5 ppg maximum limit. C/out leaking popoff valve on mud pump #2. Rig service. Unblock cuttings dryer - dump cuttings overboard under approved exception while dryer out of service.

26/06/2007 05:00

### **Activity at Report Time**

Drill 81/2" production hole.

#### **Next Activity**

Continue to drill 81/2" production hole.

25/06/2007 05:00

# Daily Operations: 24 HRS to 26/06/2007 06:00

# Well Name

Snapper A1		
Rig Name	Company	
Rig 22	Imperial Snubbing Services	
Primary Job Type	Plan	
Plug and Abandonment Only	Plug & Abandon the A1	
Target Measured Depth (ftKB)	Target Depth (TVD) (ftKB)	
3,937.0		
AFE or Job Number	Total Original AFE Amount	Total AFE Supplement Amount
40000481	2,035,000	
Daily Cost Total	Cumulative Cost	Currency
74,319	526,562	AUD
Report Start Date/Time	Report End Date/Time	Report Number
25/06/2007 06:00	26/06/2007 06:00	8

## **Management Summary**

Remove tree cap and nipple up lifting flange to tree, circulate well to 10.6ppg CaCl brine and nipple down tree. Nipple up BOPs. Run and set a plug at 453m. Start pressure testing Bop's.

## **Activity at Report Time**

Pressure test Bop's.

#### **Next Activity**

Pressure test Bop stack and Manifold. Rig up conductor line and cut tubing at 1200m.

Report End Date/Time

# Daily Operations: 24 HRS to 26/06/2007 05:00

#### Well Name

Halibut A16A

Halibut AT6A		
Rig Name	Company	
Wireline	Halliburton / Schlumberger	
Primary Job Type	Plan	
Workover PI	Workover PI	
Target Measured Depth (ftKB)	Target Depth (TVD) (ftKB)	
AFE or Job Number	Total Original AFE Amount	Total AFE Supplement Amount
L0503H030	420,000	
Daily Cost Total	Cumulative Cost	Currency
100,506	100,506	AUD
Report Start Date/Time	Report End Date/Time	Report Number
25/06/2007 05:00	26/06/2007 05:00	1

Spot Halliburton completion slickline equipment. Remove tie beams from deck rig support beams and spot Schlumberger wireline unit. Rig up Halliburton slickline unit on well. Shut down waiting on Halliburton toolbox from BBMT. Shut down for nights. Offload Halliburton toolbox, Schlumberger explosives box and Maersk H2S equipment from Lady Kari-Ann.

## **Activity at Report Time**

Waiting on daylight to begin slickline operations.

#### Next Activity

Safety meeting, begin slickline work

Page 1 of 2 Printed on 26/06/2007 ExxonMobil Use Only

<b>Daily Operations: 24 HRS</b>	to 26/06/2007 06:00	
Well Name		
Bream A9B		
Rig Name	Company	
Wireline	Halliburton / Schlumberger	
Primary Job Type	Plan	
Workover PI	Plug back existing perfs, add new perfs	
Target Measured Depth (ftKB)	Target Depth (TVD) (ftKB)	
AFE or Job Number	Total Original AFE Amount	Total AFE Supplement Amount
TBA	260,000	
Daily Cost Total	Cumulative Cost	Currency
140,158	163,138	AUD

**EAPL WellWork & Drilling Daily Operations Report** 

# Report Start Date/Time **Management Summary**

25/06/2007 06:00

RIH to set plug at 2204m MDKB. Initiated setting of plug and plug appeared to set instantly. Waited 15 mins, lifted off of plug went back down to tag top of plug. Plug was tagged at bottom of hole, 2225m MDKB. At surface, setting tool appeared to have gas in it. Tool was redressed and readied to RIH. Made-up another plug and tool, pressure tested in the Schlumberger lubricator. Plug set in lubricator. Pulled lubricator down and extracted setting tool. Identified leaked o-ring as fault. Replaced section of lubricator with set plug in it, and re-made lubricator. Pressure tested lubricator to 3000psi for 15 mins, recorded with PBMS. Waiting on HPI serviceman to redress tools and re-run another plug after he has rested.

26/06/2007 06:00

**Report Number** 

Report End Date/Time

#### **Activity at Report Time**

Standing by to re-run plug.

#### **Next Activity**

Running in the well to set HPI Plug

ExxonMobil Use Only Page 2 of 2 Printed on 26/06/2007